



1008 Park Hoog Oostduin
situation
1:4000



old situation

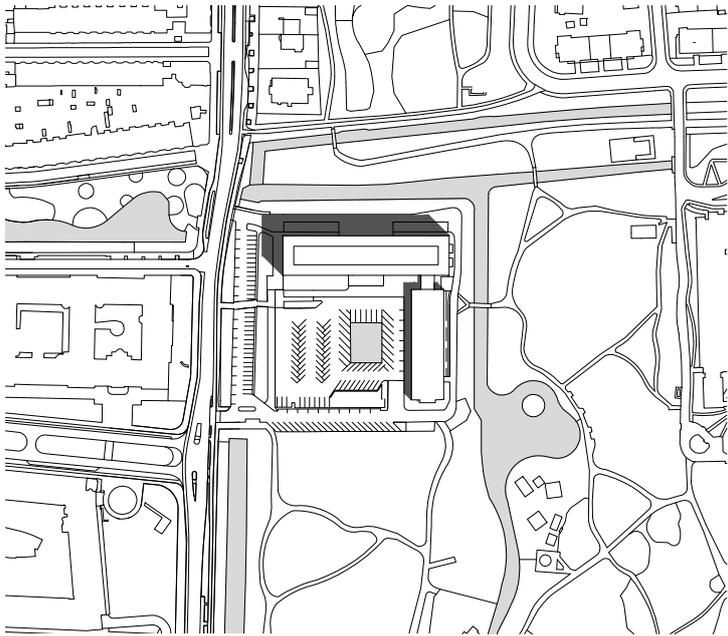

new situation




1008 Park Hoog Oostduin


floor plans

1:600

- 1. entrance
- 2. storage rooms
- 3. container space
- 4. bike park
- 5. car park
- 6. appartements

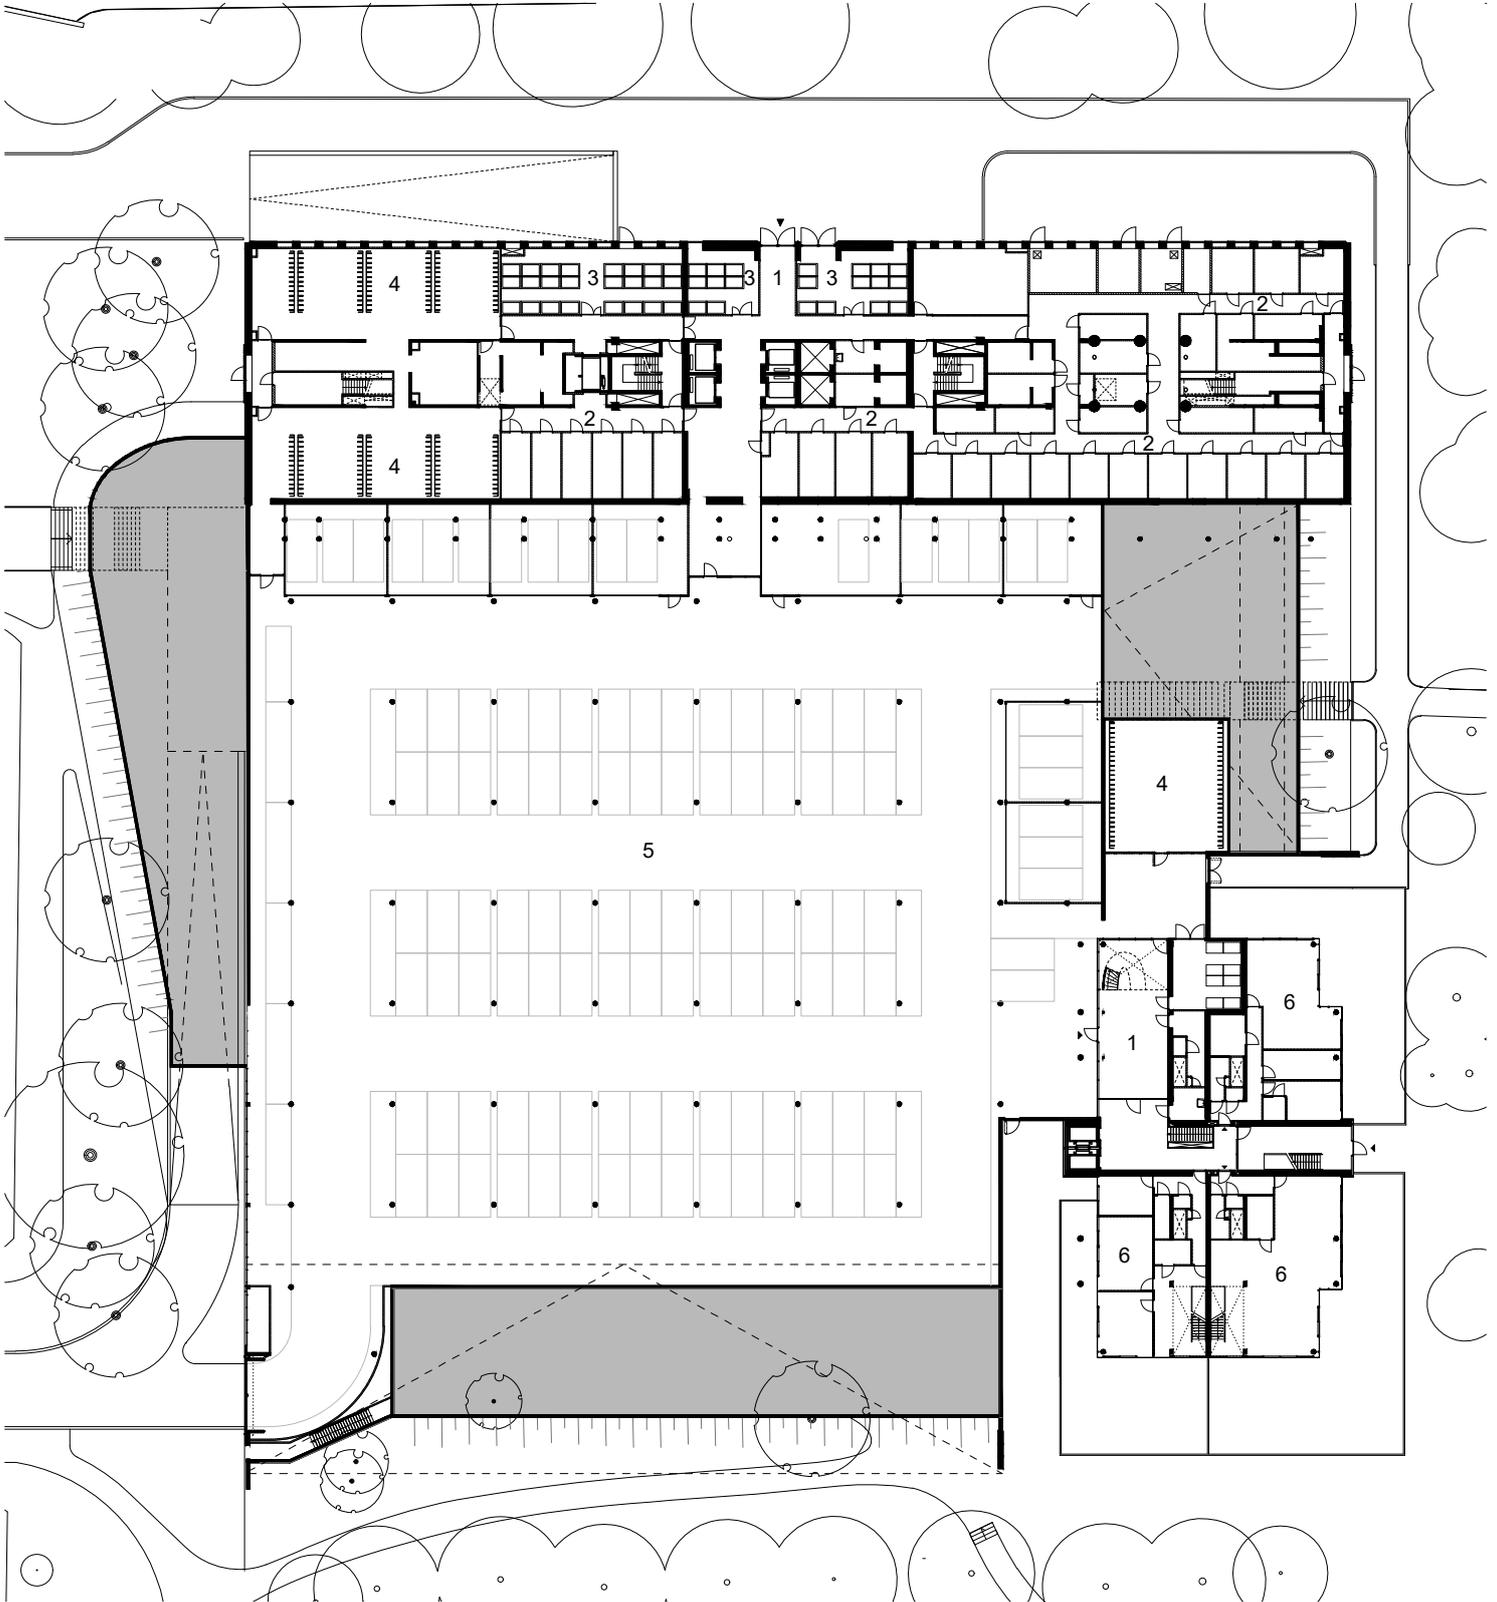


basement new situation




1008 Park Hoog Oostduin
floor plans
1:600

1. park on top of garage
2. main entrance
3. corridor to apartments
4. short stay apartments
5. hall to apartments
6. apartments

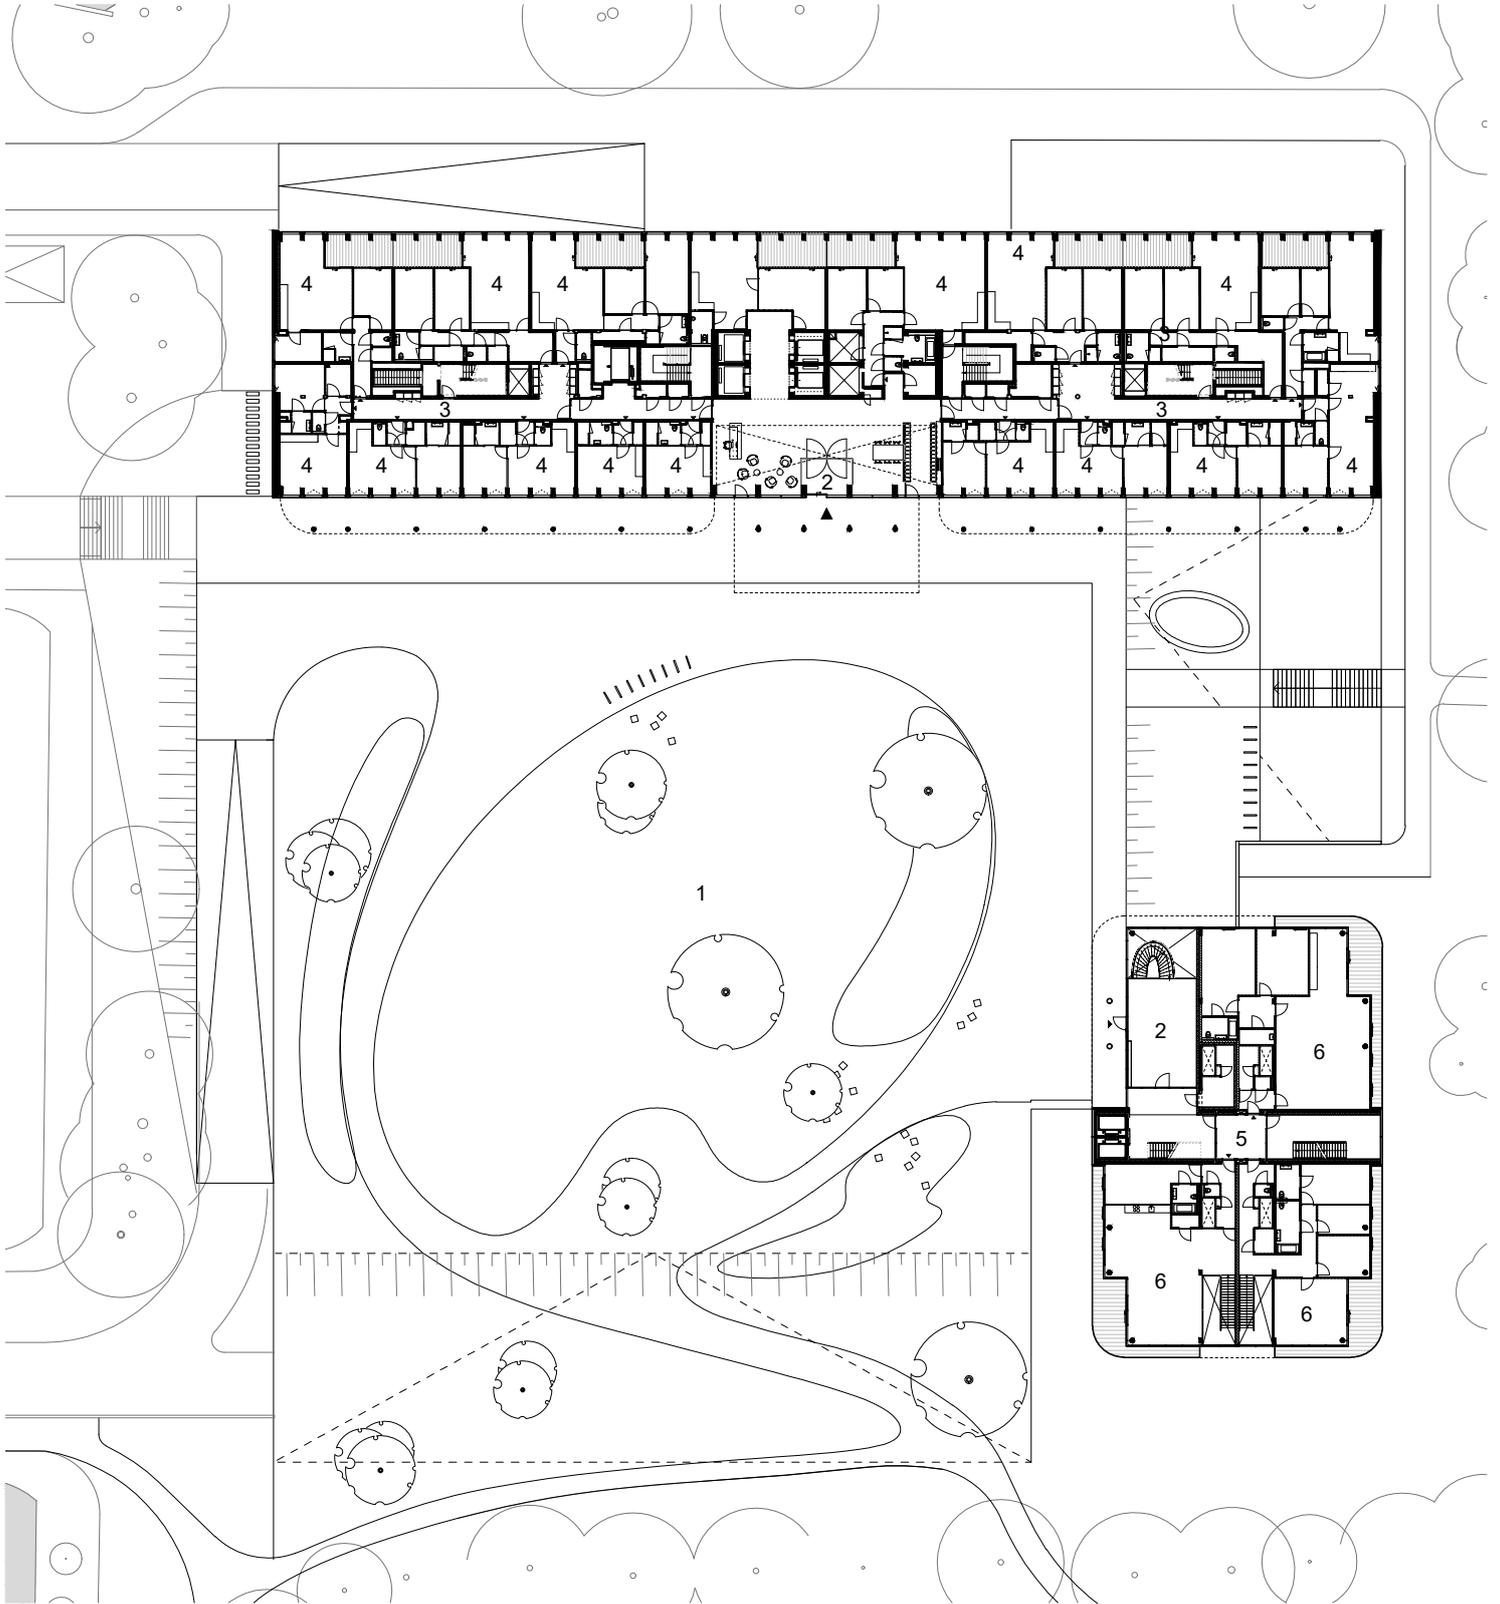

first floor new situation




1008 Park Hoog Oostduin


floor plans

1:600

- 1. office spaces
- 2. airconditioning space
- 3. auditorium

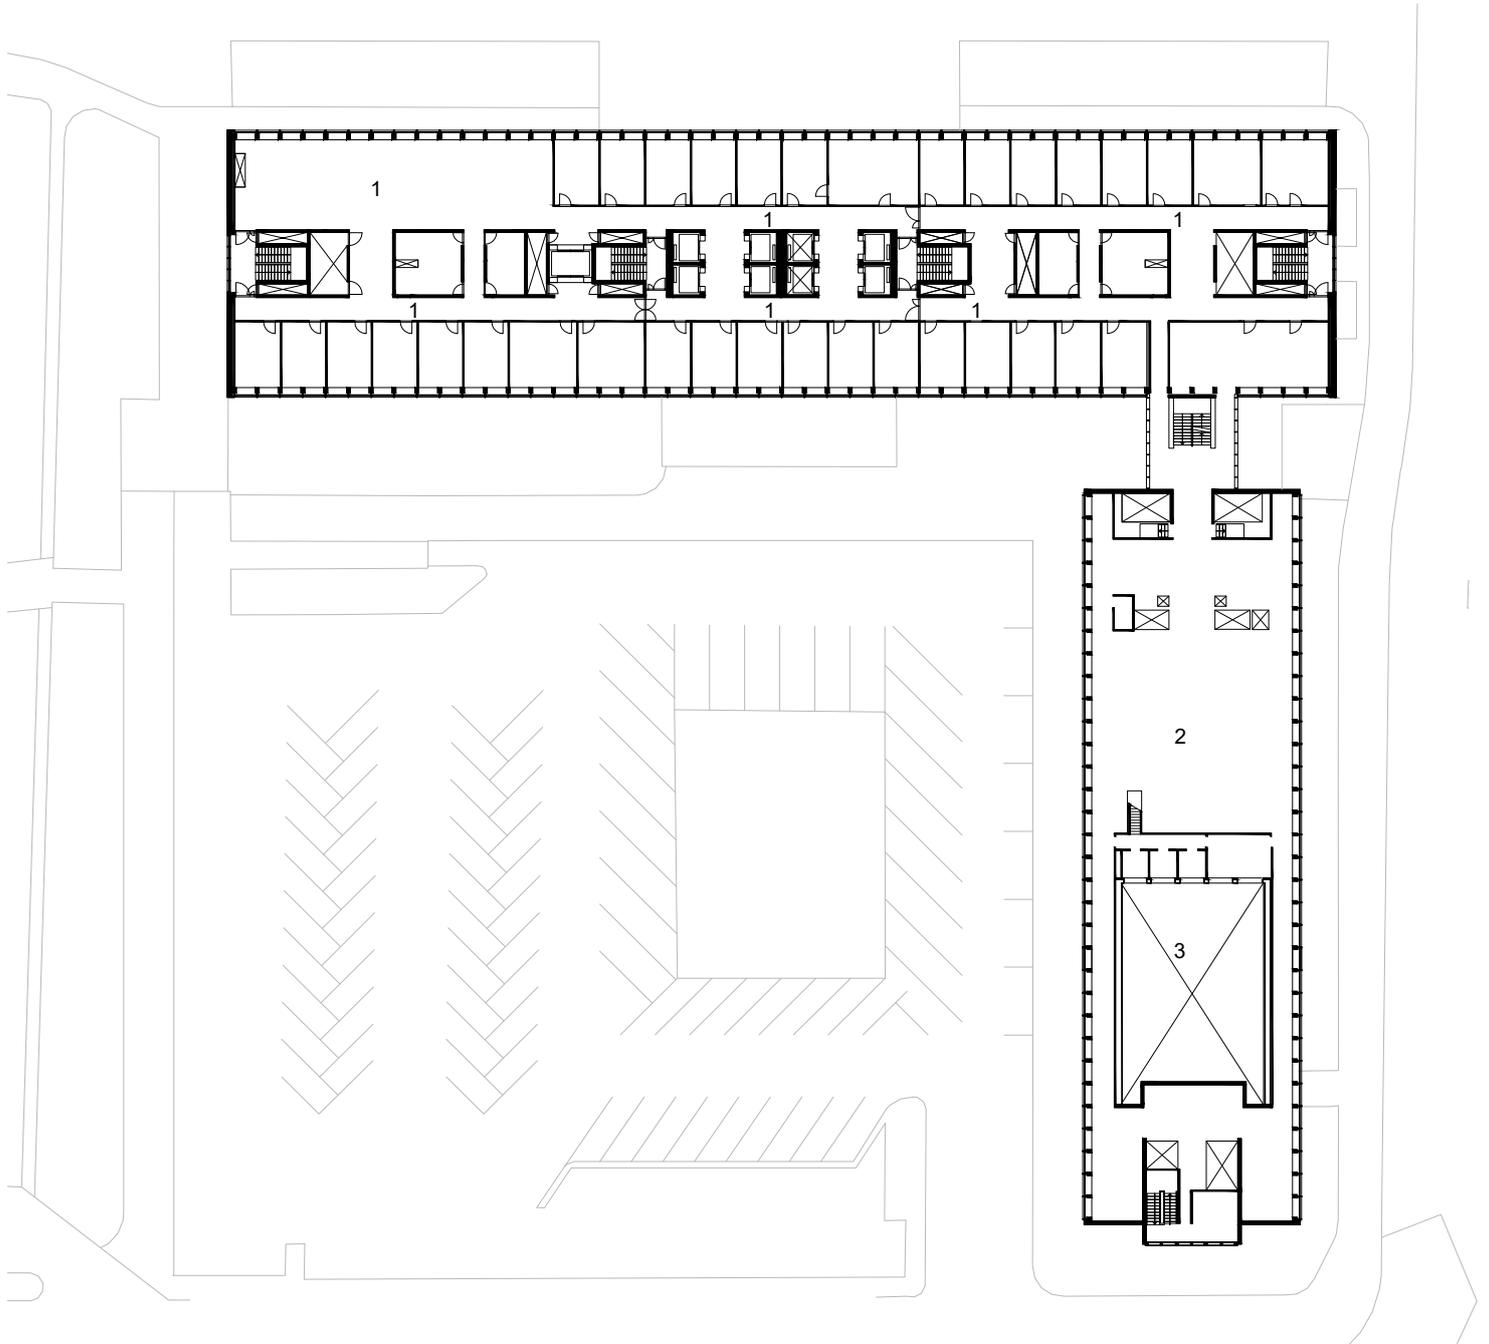

sixth floor old situation




1008 Park Hoog Oostduin


floor plans

1:600

- 1. apartments
- 2. corridor to apartments
- 3. hall to apartments

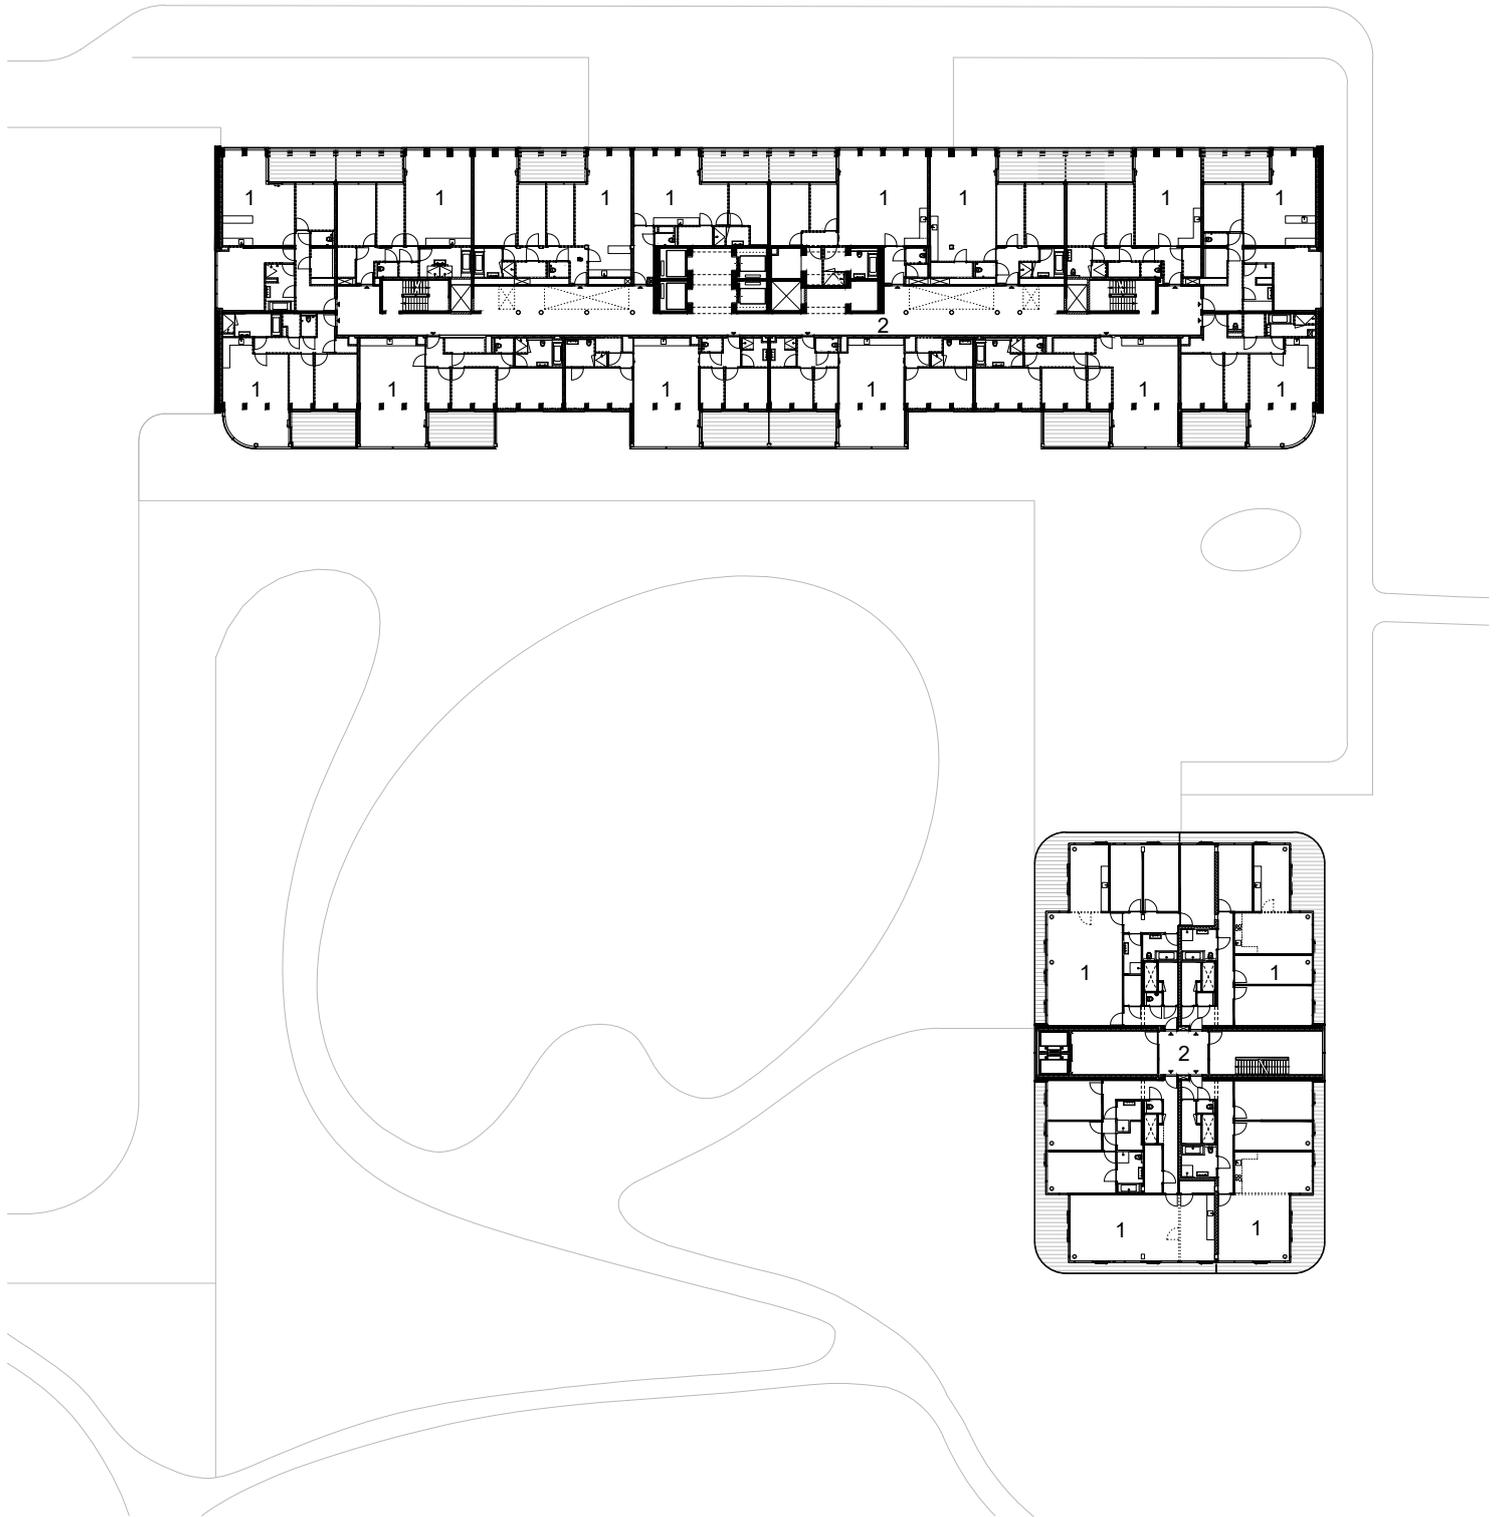

sixth floor new situation




1008 Park Hoog Oostduin


sections

1:750

- 1. apartments (floor 1-15)
- 2. penthouses (floor 16-17)
- 3. parking garage
- 4. park on top of garage

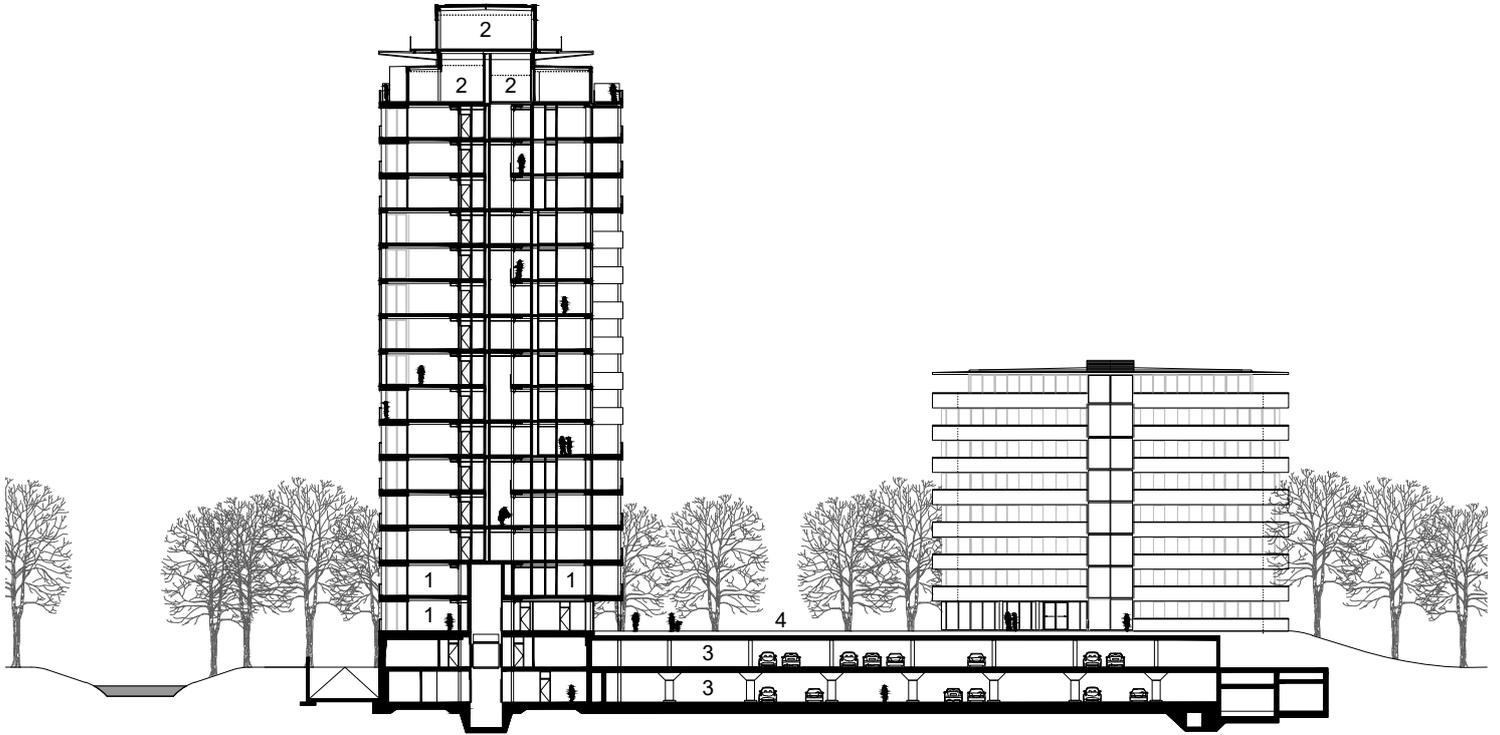

cross section through high rise




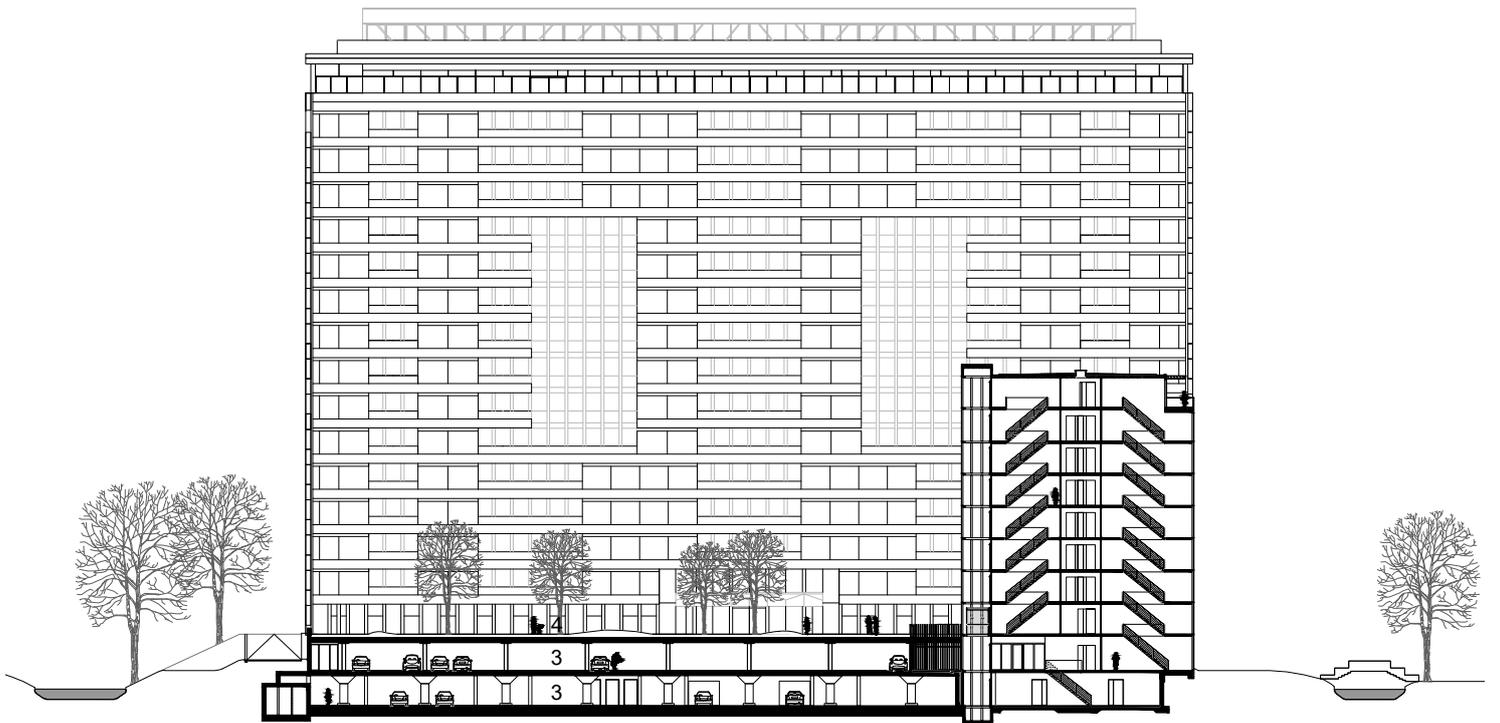


cross section through low rise




1008 Park Hoog Oostduin
façade fragment parking garage
1:50


1. roof garden
2. corten steel cassettes, mounted invisibly by means of bed hooks
3. escape door fitted with perforated corten steel cassettes, invisibly mounted by means of bed hooks
4. parking garage ventilation grids hidden behind perforated corten steel cassettes
5. mechanically sliding folding doors with perforated corten steel panels

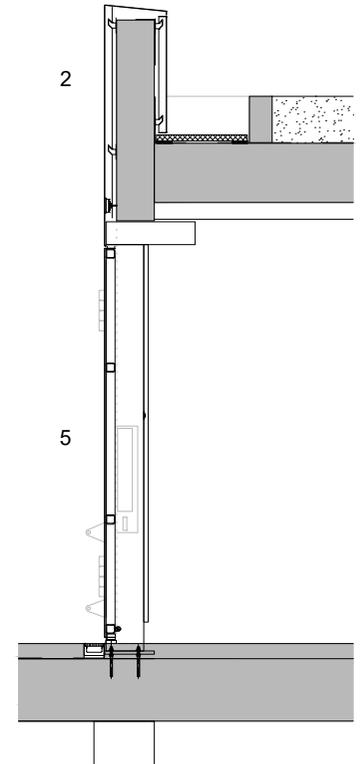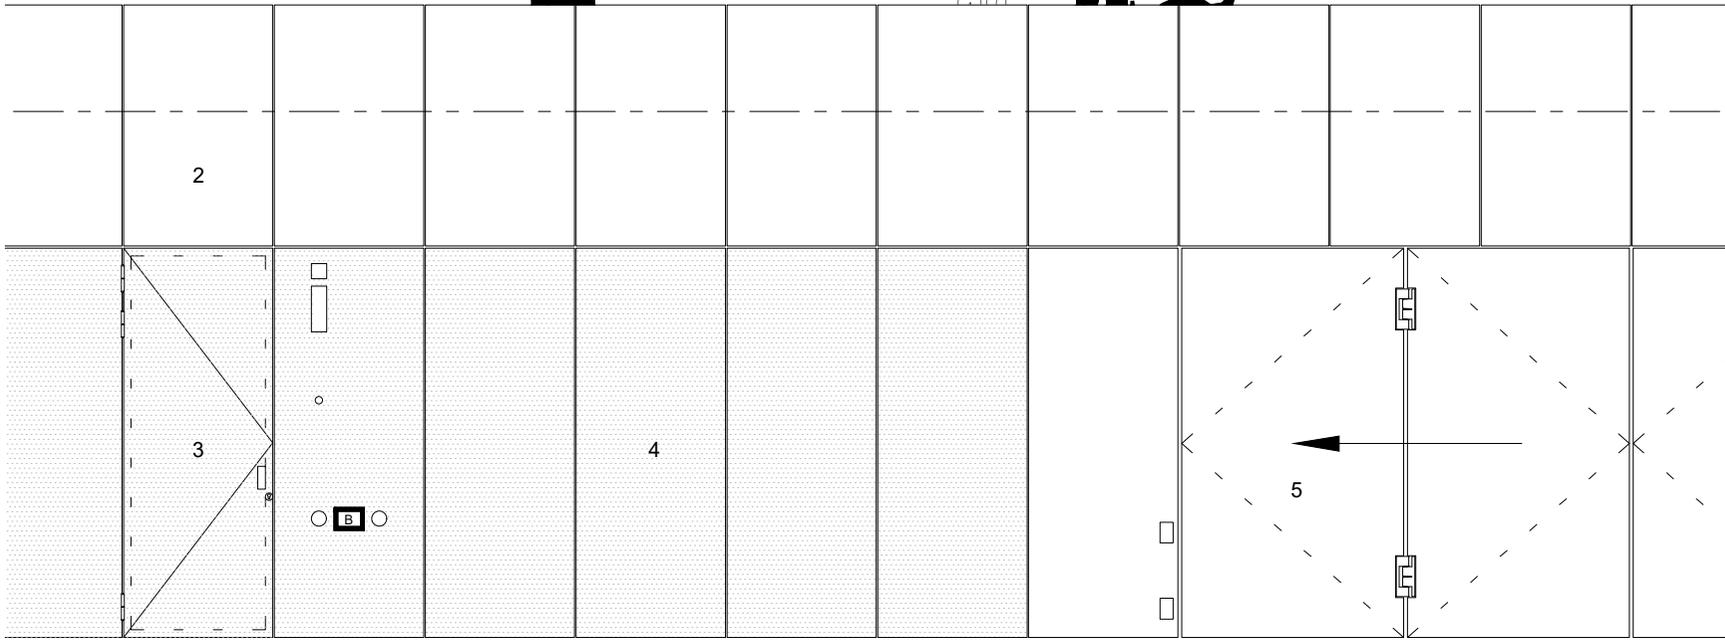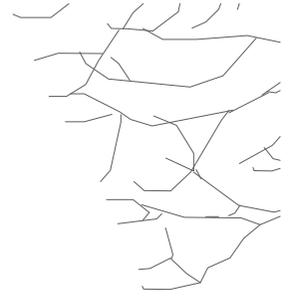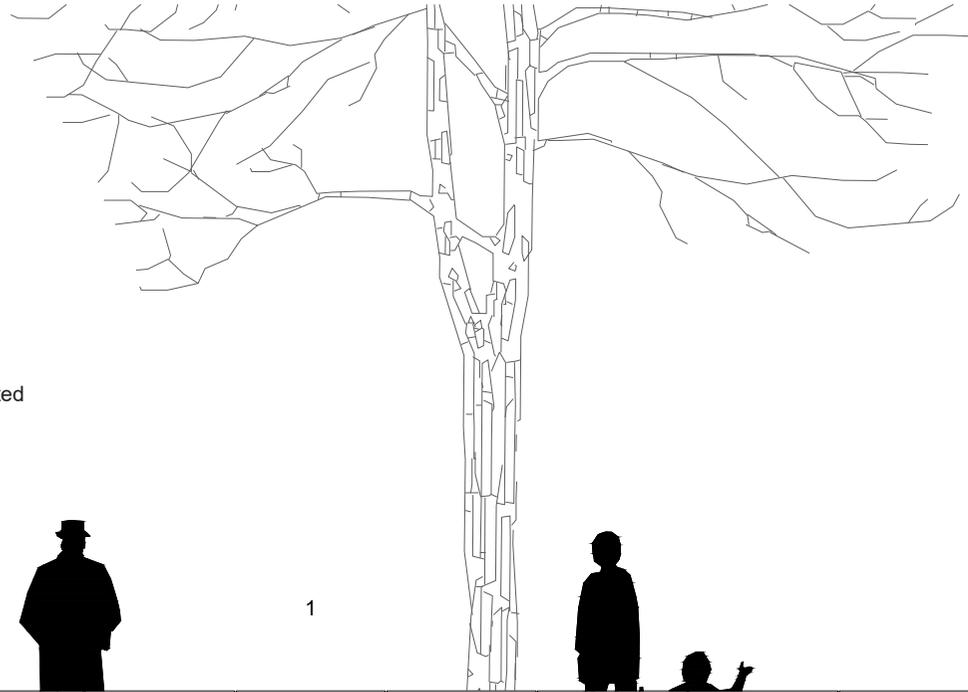

1008 Park Hoog Oostduin
fragment floor plan
1:150

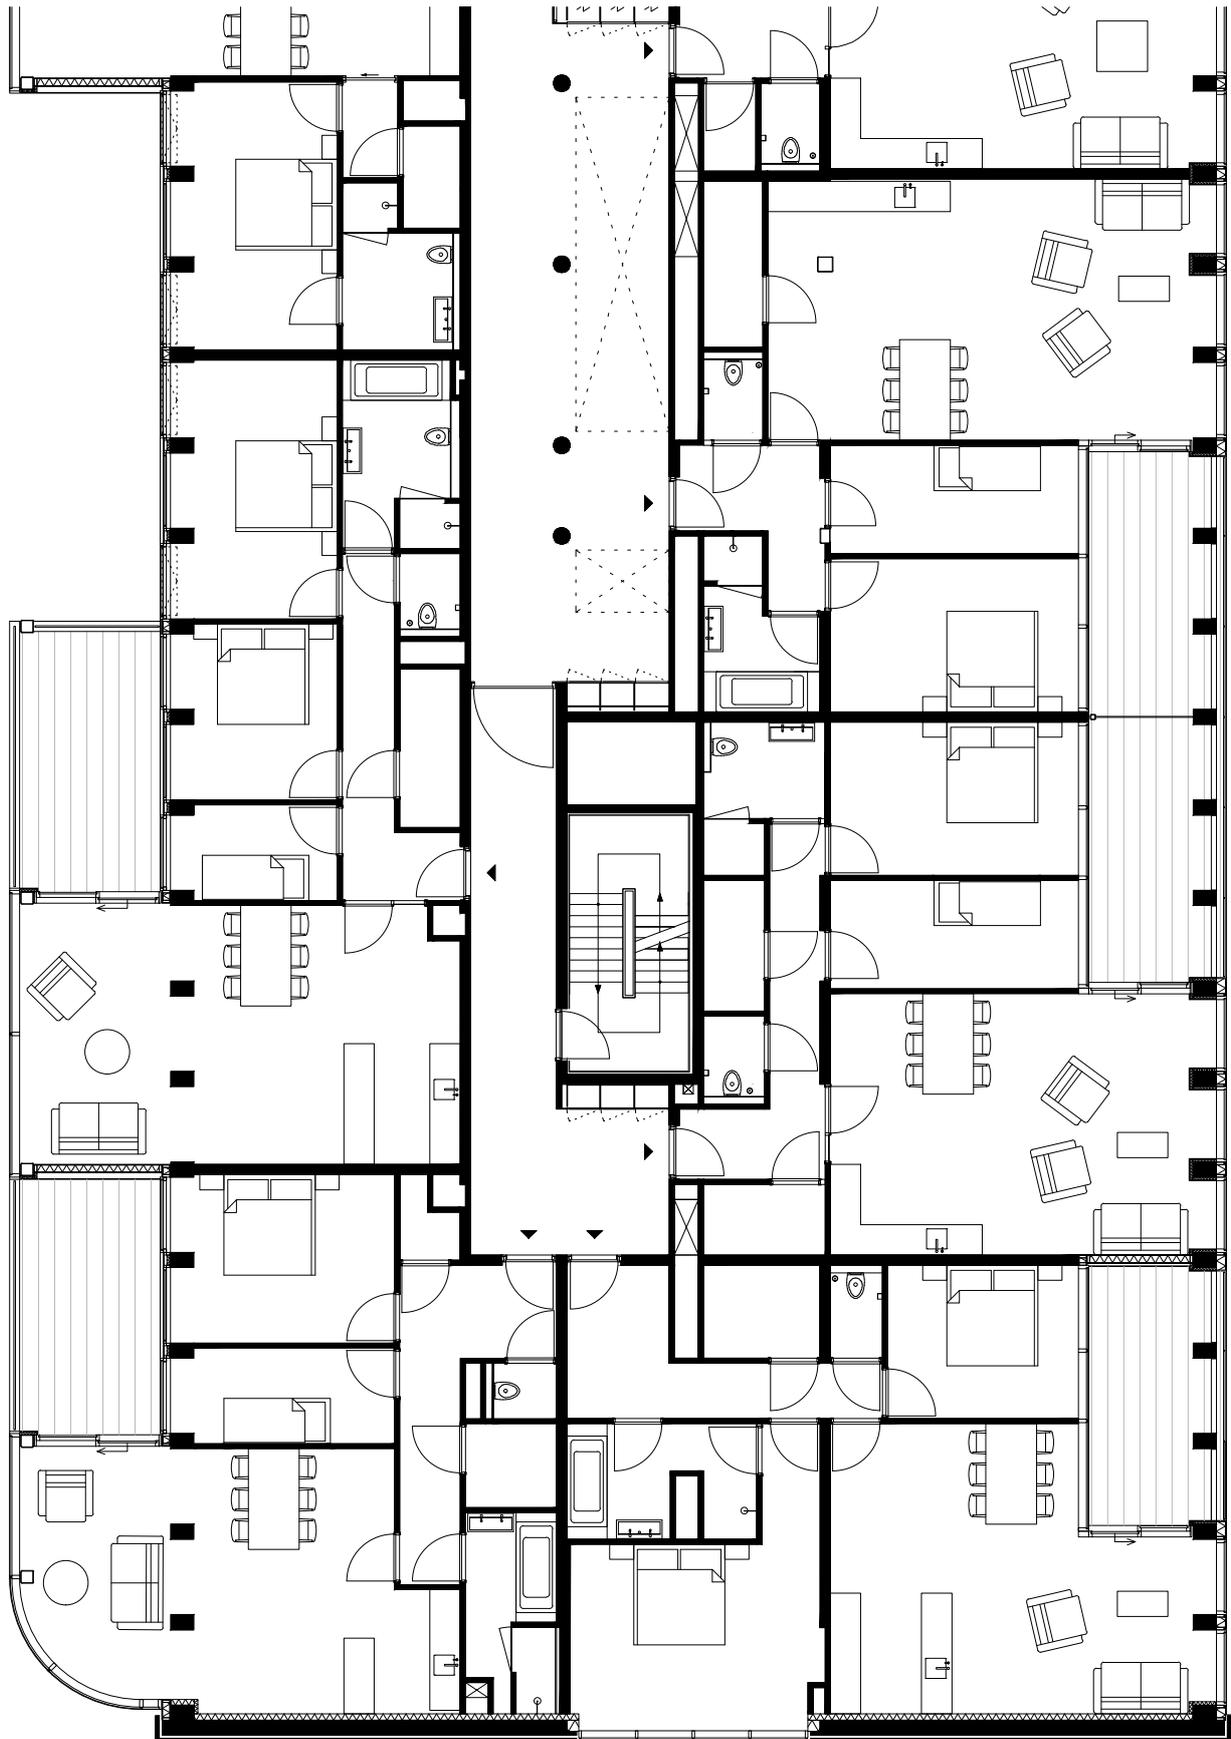


sixth floor new situation




1008 Park Hoog Oostduin
fragment hoge duin
1:150

- 1. penthouse
- 2. apartment
- 3. corridor to apartments

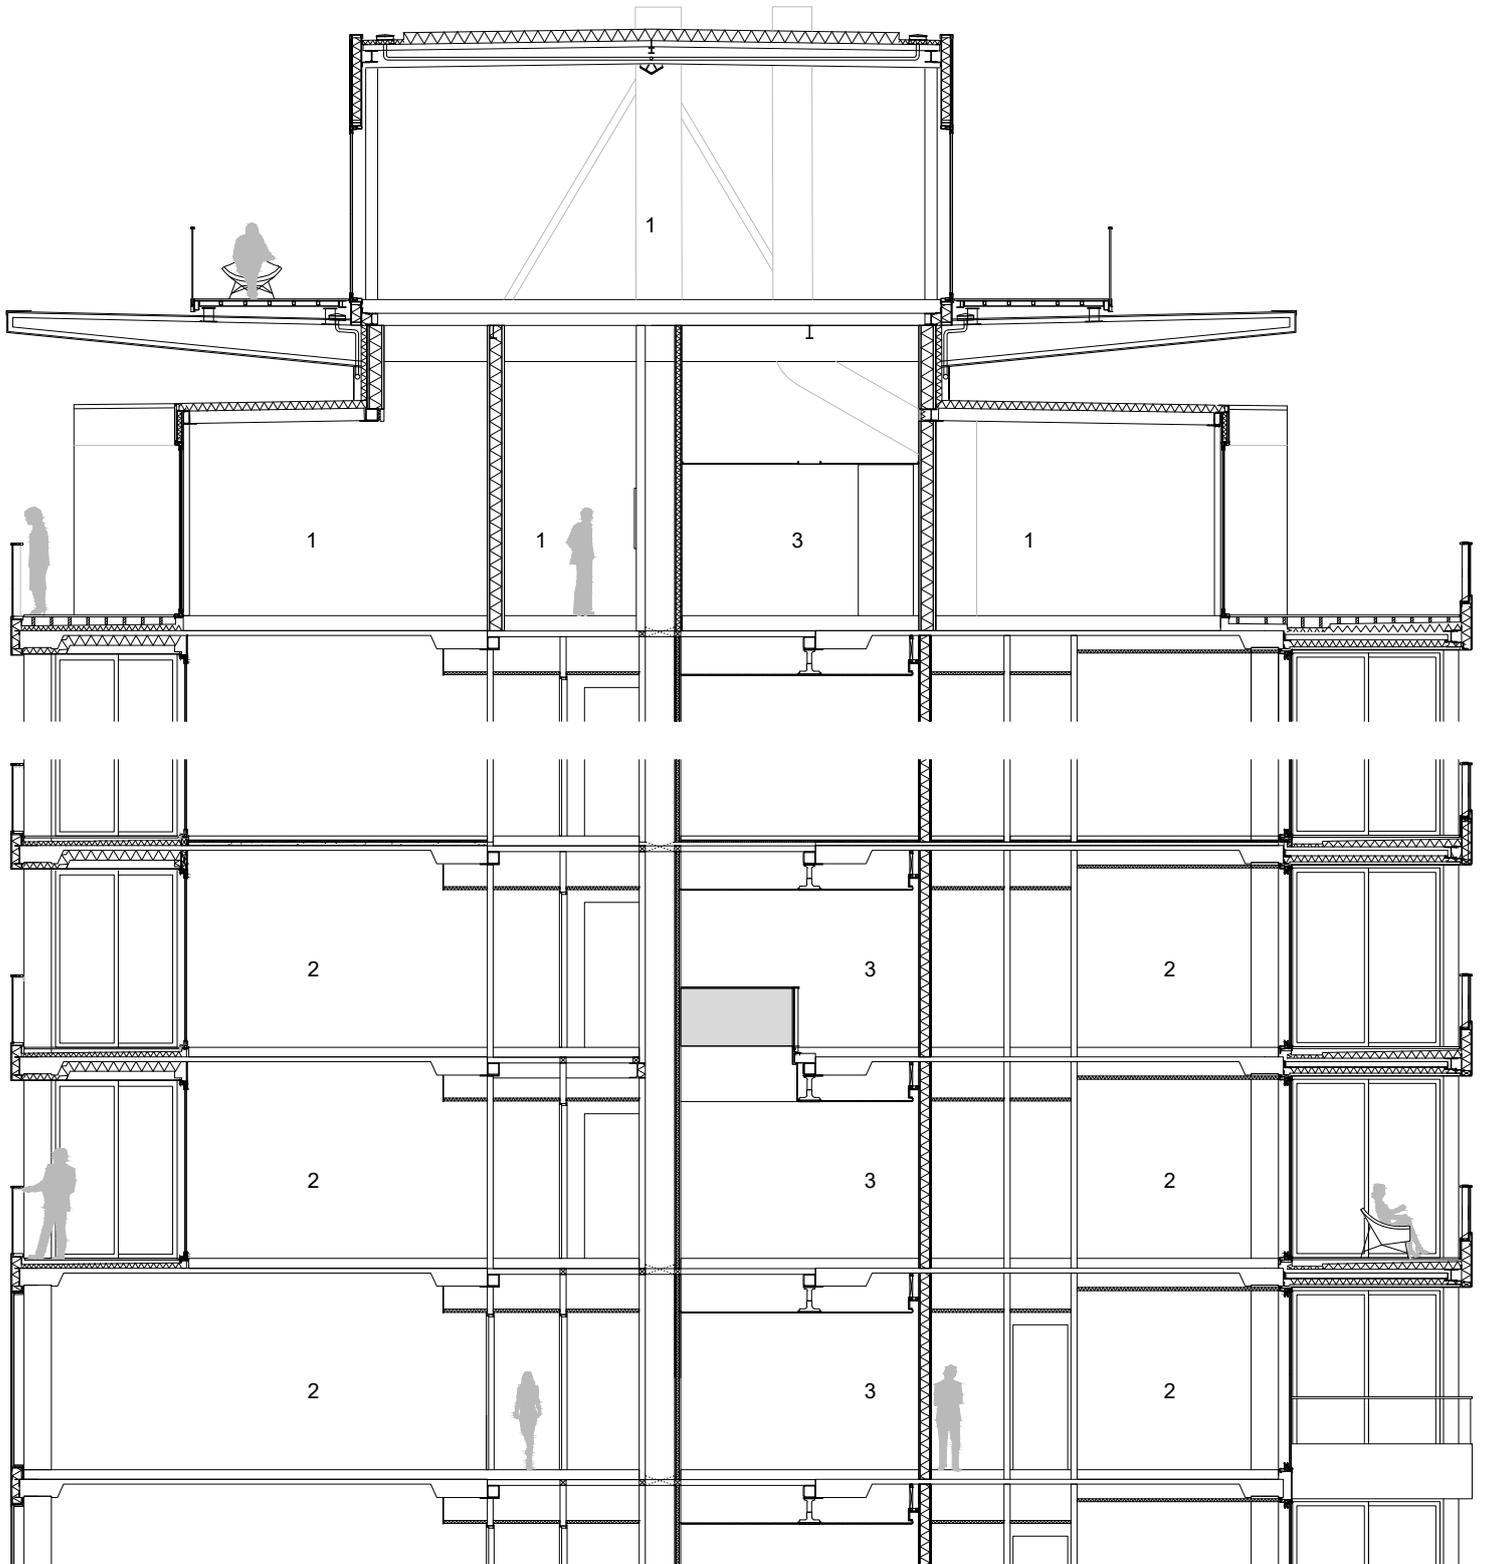

1008 Park Hoog Oostduin
vertical façade detail high rise
1:10


1. aluminum balcony railings with clear double glazing, clamped in rubber profiles
2. fire resistant coated steel construction
3. steel mounting profile for balustrade
4. opaque colored enameled glass siding
5. sandwich facade element with insulation and Fermacell plating
6. Cempanel plus balcony finish
7. hardwood decking balcony deck
8. balcony insulation with a slope, with EPDM roofing
9. integrated downlight
10. floating anhydrite screed with underfloor heating
11. aluminum sliding door with double glazing

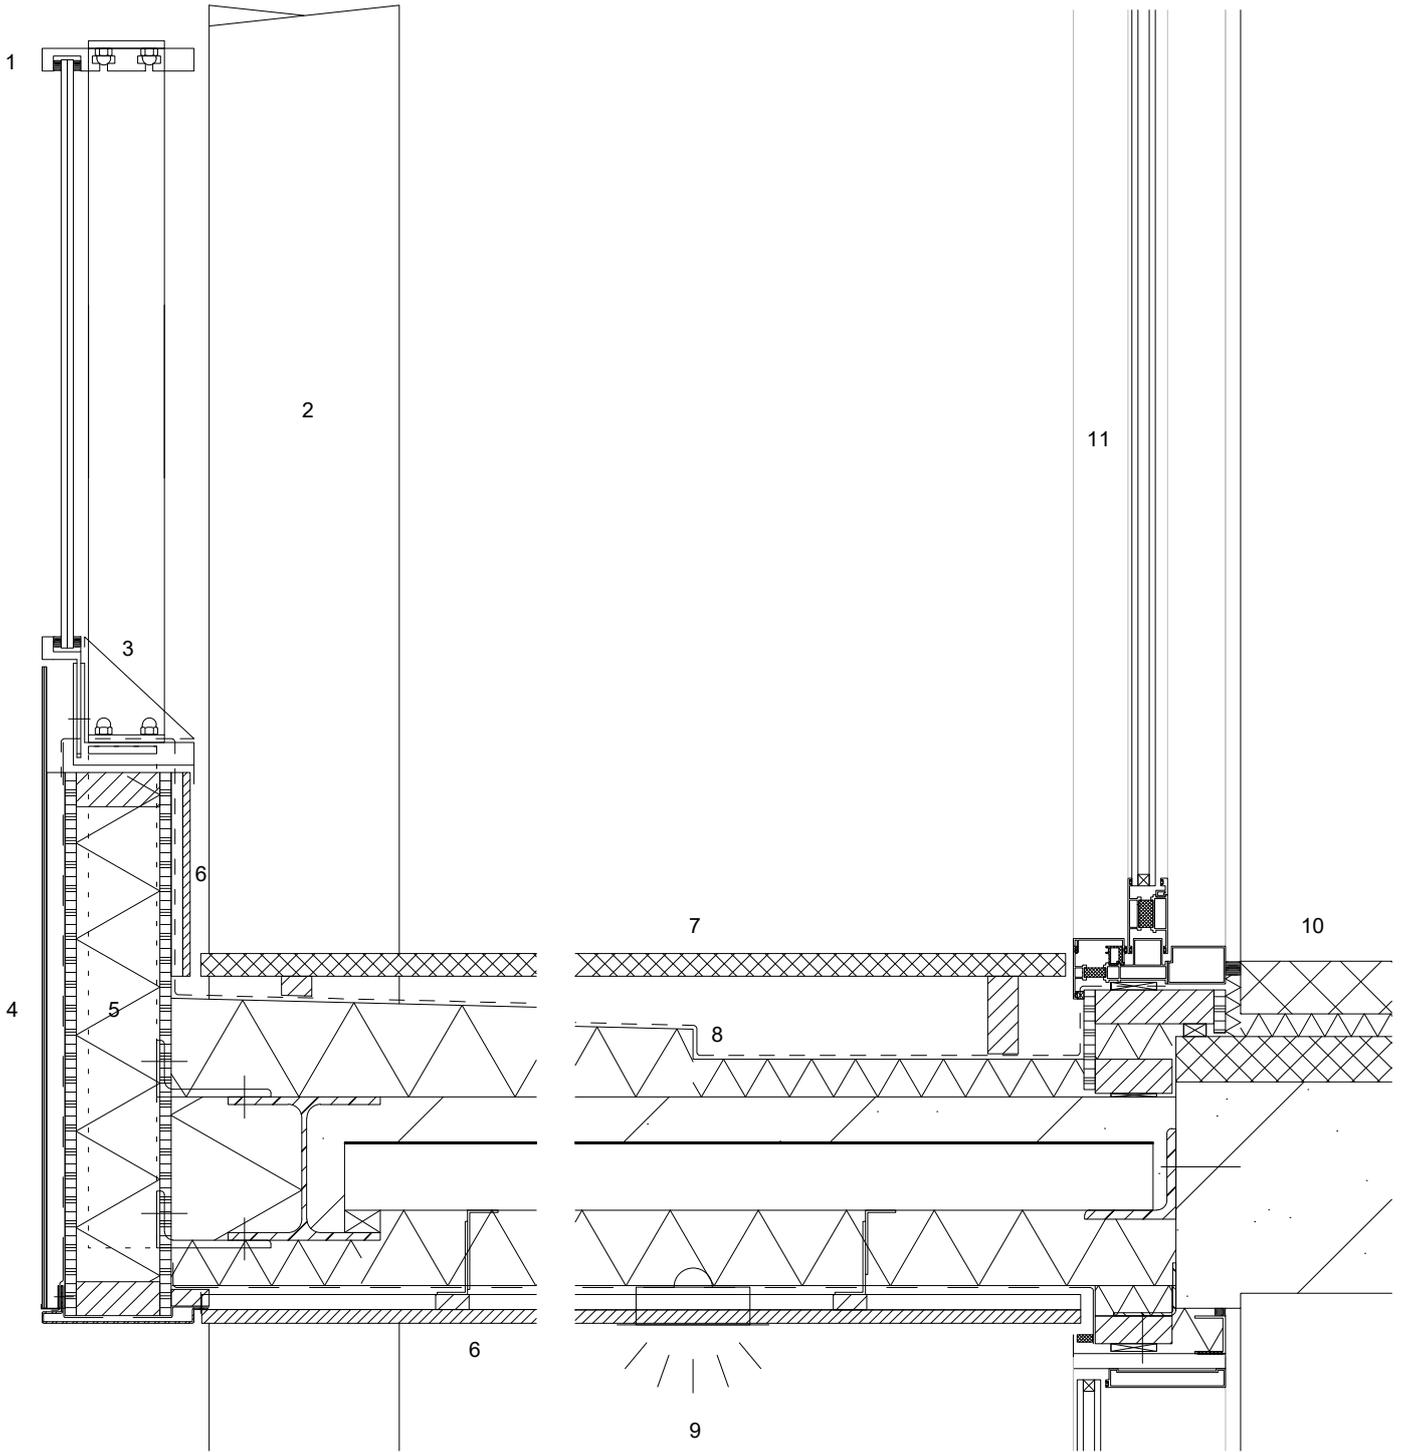


0m 0.5m

1008 Park Hoog Oostduin
 vertical façade detail low rise
 1:10


1. pluvia
2. metal eaves
3. insulation with EPDM roofing
4. powder coated folded metal
5. steel console for awning construction
6. steel awning with aluminum louvres
7. fire resistant coated steel construction
8. aluminum frames with triple glazing
9. concrete slab floor
10. concrete tile floor slabs balcony
11. precast reinforced concrete balcony elements
12. aluminum balustrade with hardened and laminated glass

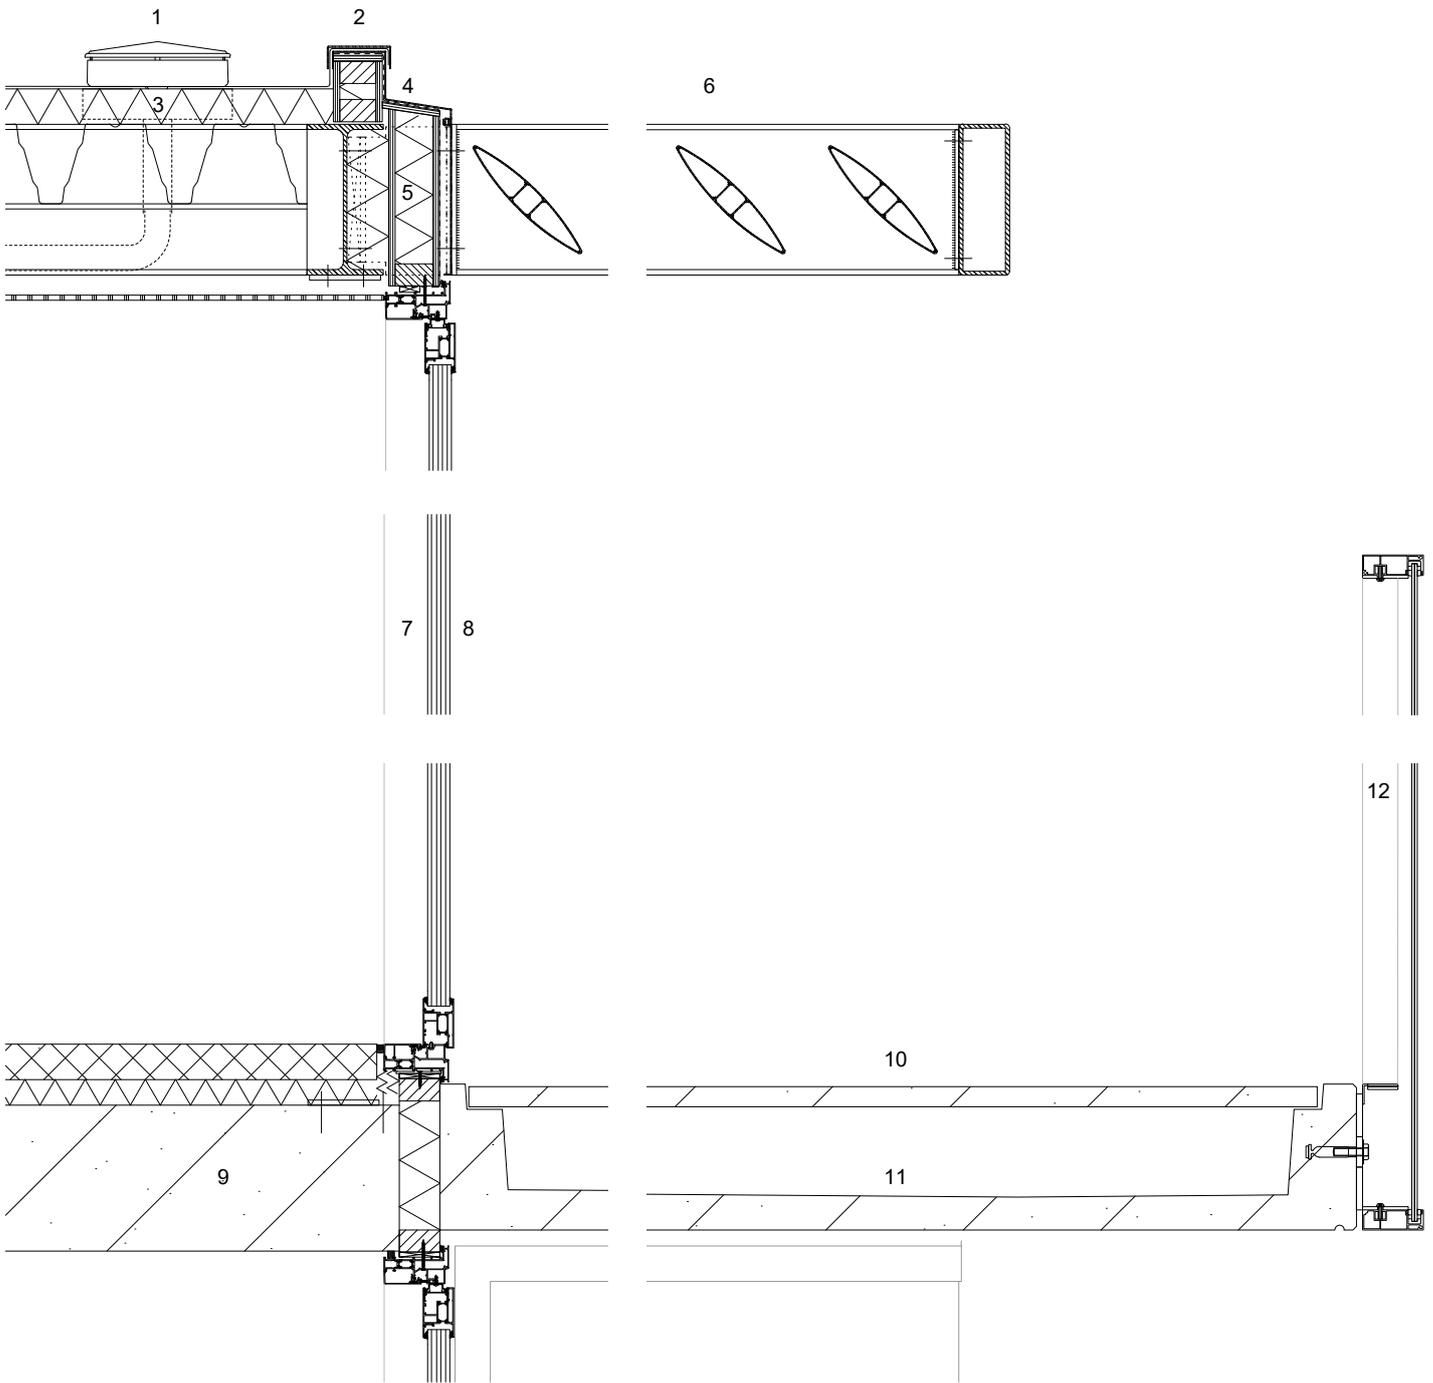


1008 Park Hoog Oostduin
3d outline
existing - addition - new

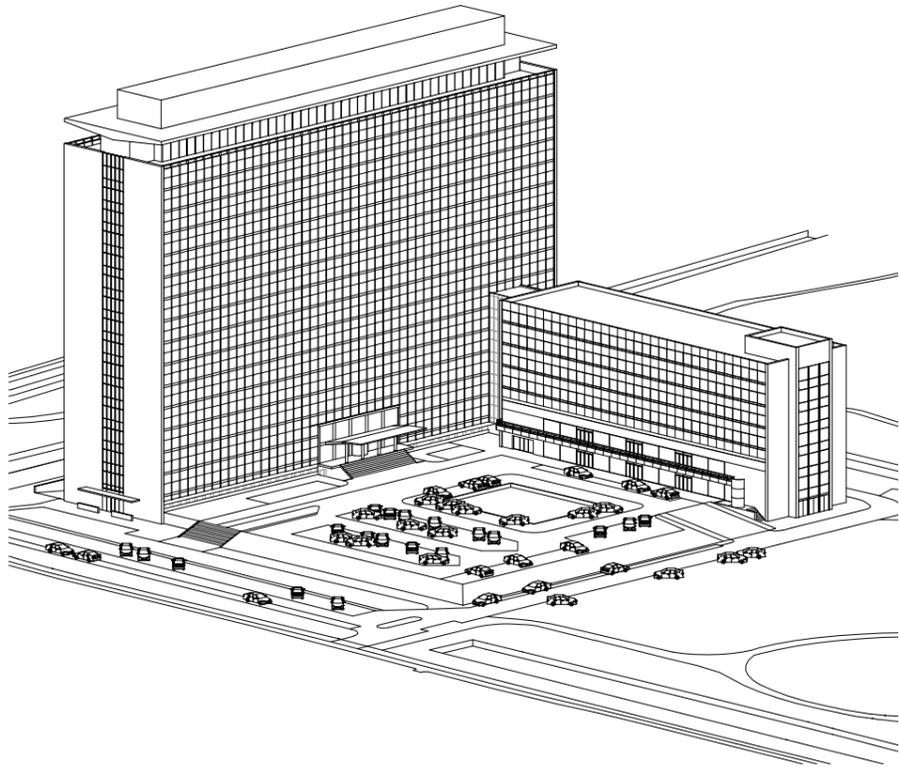

existing situation

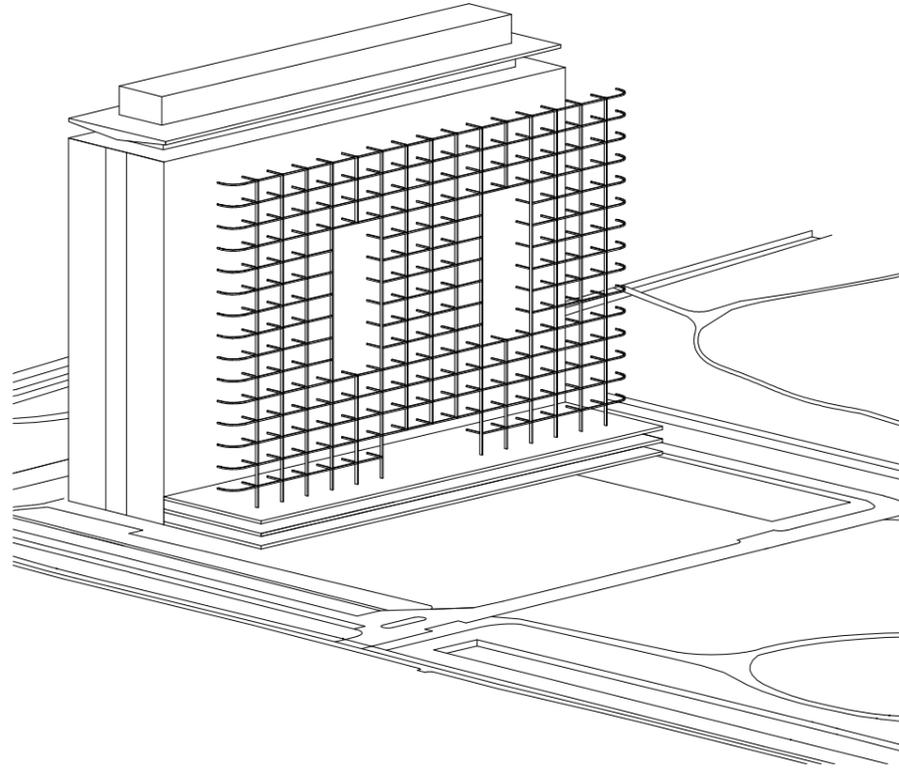

addition of rack construction

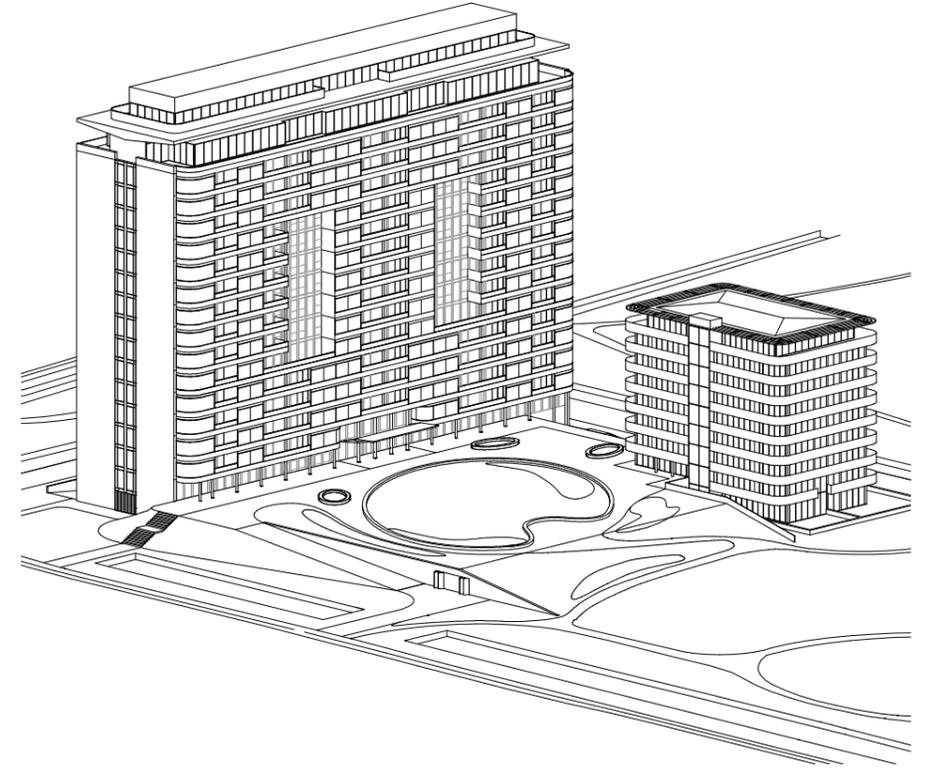

new situation